



# 5

## Set Default Decimal Point


1. Press MENU. The meter displays:

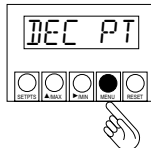

2. Press ►/MIN to display the current decimal point. Change the display, if necessary, to read "FFFFFF." (Use ▲/MAX to change the decimal point position).

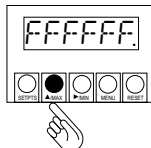


3. Press MENU. The meter stores changes (if applicable), then displays "CNT BY".

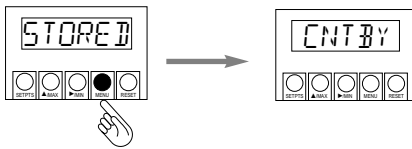


4. Press RESET twice. The meter momentarily displays "RESET 2" then returns to the run mode. The meter will now read the input signal (4mA = ≈ 000000. and 20mA = ≈ 020000.).

## Measure and Record Input Values


1. Apply 4mA to the input and record the display reading. INPUT 1 = \_\_\_\_\_ Refer to this as Input One.

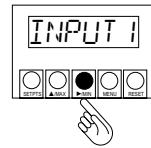


2. Apply 20mA to the input and record the display reading. INPUT 2 = \_\_\_\_\_ Refer to this as Input Two.

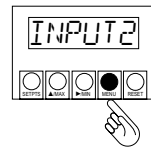

3. Press MENU until the meter displays:

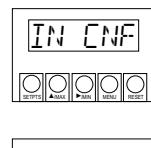


4. Press MENU until the meter displays:

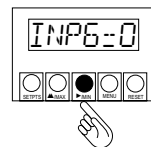

Press ►/MIN to display "INP6=0" Change the meter to read "INP.6=1" (Use ►/MIN to scroll through digits and ▲/MAX to change the digit's value).


5. Press MENU. The meter stores changes and displays:

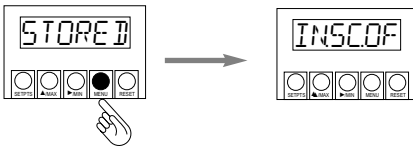

# 6


## Scale Input Values

1. Press ►/MIN to display "INPUT 1":

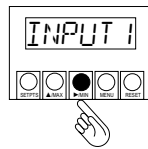


Press ►/MIN again. The meter displays "000000". Enter the INPUT 1 value recorded in step 1 of the Measure Input Values section of this quick start.

2. Press MENU. The meter displays "READ 1":

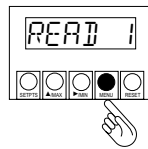


Press ►/MIN to display a six-digit number. Change the meter to read "000000". (Use ►/MIN to scroll through digits and ▲/MAX to change the digit's value.)

3. Press MENU. The meter displays "INPUT 2":

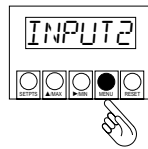


Press ►/MIN. The meter displays "000000". Enter the INPUT 2 value recorded in step 2 of the Measure Input Values section of this quick start.

4. Press MENU. The meter displays "READ 2":

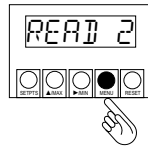


Press ►/MIN to display a six digit number. Change the meter to read "001000". (Use ►/MIN to scroll through digits and ▲/MAX to change the digit's value.)

5. Press MENU. The meter stores changes and displays:

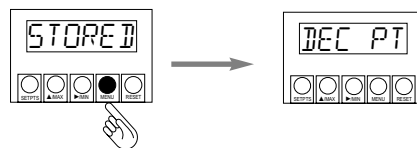


6. Press ►/MIN to display the current decimal point. Press ▲/MAX to change the decimal point location to "FFFFFF.F".

7. Press MENU. The meter stores this change, then displays "CNT BY"

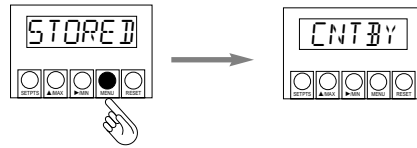

8. Press RESET twice. The meter displays: "RESET 2", then returns to the run mode. The meter is now scaled to read 0 to 100.0 for a 4-20 mA input.

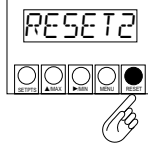

**WARNING:** These products are not designed for use in, and should not be used for, patient connected applications.

This device is marked with the international caution symbol. It is important to read the Setup Guide before installing or commissioning this device as it contains important information relating to safety and EMC.

It is the policy of NEWPORT to comply with all worldwide safety and EMC/EMI regulations that apply. NEWPORT is constantly pursuing certification of its products to the European New Approach Directives. NEWPORT will add the CE mark to every appropriate device upon certification.

The information contained in this document is believed to be correct, but NEWPORT Electronics, Inc. accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.

### TRADEMARK NOTICE:

**NEWPORT**, **NEWPORT**, [newportUS.com](http://newportUS.com), **INFINITY**, and the "Meter Bezel Design" are trademarks of NEWPORT Electronics, Inc.

### Warranty/Disclaimer

NEWPORT Electronics, Inc. warrants this unit to be free of defects in materials and workmanship for a period of one (1) year from the date of purchase. In addition to NEWPORT's standard warranty period, NEWPORT Electronics will extend the warranty period for one (1) additional year if the warranty card enclosed with each instrument is returned to NEWPORT.

If the unit should malfunction, it must be returned to the factory for evaluation. NEWPORT's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by NEWPORT, if the unit is found to be defective it will be repaired or replaced at no charge. NEWPORT's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of being damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of NEWPORT's control. Components which wear are not warranted, including but not limited to contact points, fuses, and triacs.

NEWPORT is pleased to offer suggestions on the use of its various products. However, NEWPORT neither assumes responsibility for any omissions or errors nor assumes liability for any damages that result from the use of its products in accordance with information provided by NEWPORT, either verbal or written. NEWPORT warrants only that the parts manufactured by it will be as specified and free of defects. NEWPORT MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive and the total liability of NEWPORT with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall NEWPORT be liable for consequential, incidental or special damages.

CONDITIONS: Equipment sold by NEWPORT is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 10 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, or used on humans, or misused in any way, NEWPORT assumes no responsibility as set forth in our basic WARRANTY / DISCLAIMER language, and additionally purchaser will indemnify NEWPORT and hold NEWPORT harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

### Return Requests/Inquiries

Direct all warranty and repair requests/inquiries to the NEWPORT Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO NEWPORT, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM NEWPORT'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR WARRANTY RETURNS, please have the following information available BEFORE contacting NEWPORT:

1. P.O. number under which the product was PURCHASED.
2. Model and serial number of the product under warranty, and
3. Repair instructions and/or specific problems relative to the product.

FOR NON-WARRANTY REPAIRS, consult NEWPORT for current repair charges. Have the following information available BEFORE contacting NEWPORT:

1. P.O. number to cover the COST of the repair,
2. Model and serial number of product, and
3. Repair instructions and/or specific problems relative to the product.

NEWPORT's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

NEWPORT is a registered trademark of NEWPORT Electronics, Inc.

© Copyright 2002 NEWPORT Electronics, Inc. All rights reserved.

This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without prior written consent of NEWPORT Electronics, Inc.

PATENT NOTICE: This product is covered by one or more of the following patents: U.S. Pat. No. Des. 336,895; 5,274,577 / CANADA 2052599; 2052600 / ITALY 1249456; 1250938 / FRANCE BREVET No. 91 12756 / SPAIN 2039150; 2048066 / UK PATENT No. GB2 249 837; GB2 248 954 / GERMANY DE 41 34398 C2. OTHER INTERNATIONAL PATENTS PENDING.

# QUICK START



# INFINITY

SERIES

THE NEW STANDARD FOR QUALITY

## INFP

### High Performance Process Indicator

For immediate technical or application assistance please call:

# 1-800-6397678

# 1-800-NEWPORT

Newport Electronics, Inc.  
2229 South Yale Street • Santa Ana, CA • 92704 • U.S.A.  
TEL: (714) 540-4914 • FAX: (714) 546-3022  
Toll Free: 1-800-639-7678 • <http://www.newportUS.com> • e-mail: [info@newportUS.com](mailto:info@newportUS.com)  
ISO 9001 Certified

Newport Technologies, Inc.  
976 Bergar • Laval (Quebec) • H7L 5A1 • Canada  
TEL: (514) 335-3183 • FAX: (514) 856-6886  
Toll Free: 1-800-639-7678 • <http://www.newport.ca> • e-mail: [sales@newport.ca](mailto:sales@newport.ca)

Newport Electronics, Ltd.  
One Omega Drive • River Bend Technology Centre  
Northbank, Irlam • Manchester M44 5BD • United Kingdom  
Tel: +44 161 777 6611 • FAX: +44 161 777 6622  
Toll Free: 0800 488 488 • <http://www.newportuk.co.uk> • e-mail: [sales@newportuk.co.uk](mailto:sales@newportuk.co.uk)

Newport Electronics B.V.  
Postbus 8034 • 1180 LA Amstelveen • The Netherlands  
TEL: +31 20 3472121 • FAX: +31 20 6434643  
Toll Free: 0800 0993344 • <http://www.newport.nl> • e-mail: [sales@newport.nl](mailto:sales@newport.nl)

Newport Electronics spol s.r.o.  
Rudé armády 1868, 733 01 Karviná 8 • Czech Republic  
TEL: +420 69 6311899 • FAX: +420 69 6311114  
Toll Free: 0800-1-66342 • <http://www.newport.cz> • e-mail: [sales@newport.cz](mailto:sales@newport.cz)

Newport Electronics GmbH  
Daimlerstrasse 26 • D-75392 Deckenpfronn • Germany  
TEL: 49 7056 9398-0 • FAX: 49 7056 9398-29  
Toll Free: 0800 / 6397678 • <http://www.newport.de> • e-mail: [sales@newport.de](mailto:sales@newport.de)

Newport Electronique S.A.R.L.  
9, rue Denis Papin • 78190 Trappes • France  
TEL: +33 130 621 400 • FAX: +33 130 699 120  
Toll Free: 0800-4-06342 • <http://www.newport.fr> • e-mail: [sales@newport.fr](mailto:sales@newport.fr)

Mexico and Latin America  
TEL: 001-800-826-6342 • FAX: 001 (203) 359-7807  
En Español: 001 (203) 359-7803

**NEWPORTnet**™ On-Line Service [www.newportUS.com](http://www.newportUS.com) **Internet e-mail** [info@newportUS.com](mailto:info@newportUS.com)

**NEWPORT Electronics, Inc.**

## START HERE

### Using This Quick Start Manual

Use this Quick Start Manual to get your High Performance Process Indicator up and running. These instructions use the factory default settings of current input and 24 Vdc sensor excitation. To start your unit you:

- connect ac power
- wire the sensor
- configure the meter, using the front panel buttons and the configuration menus

### Before You Begin

Check the serial label on the top of the meter case. The model number's last 3 digits indicate if the meter is set up for voltage or current. C1 - C2 are current ranges and DC1 - DC10 are voltage ranges. **This quick start manual uses the C2 (4 - 20mA) range.** If your meter is setup for a range other than C2, consult the reference manual.

Your unit should have the following parts:


- Meter
- Front panel button cover
- Panel mounting gaskets
- ac Power Connector (orange -P1), Input Connectors (2) (grey -P3 and P9), and rear protective cover (mounted).

Contact the nearest Customer Service Department using the numbers listed on the front of this quickstart manual if any of these parts are missing, or if you have questions. In addition to the unit and related parts, you will need the following items to set up your unit:

- ac power, as listed on meter's Product/ID
- 4-20mA input (eg: load cell, calibrator)
- 1/8" Phillips head screwdriver
- 1/8" flat blade screwdriver

### Connect ac Power

1. Remove the rear protective cover and set it aside. The cover is secured with a Phillips-head screw.
2. Locate connector P1 on the bottom-left-rear of the unit. The connector has three screw-down terminals.
3. Insert the correct wire in each terminal and tighten the lockdown screw. Tug gently on each wire to verify the connection.

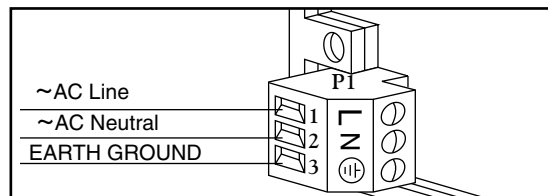

P1 Connector


## 2

### Wiring a Current Transmitter

Follow these steps to wire a current input sensor with sensor excitation.

1. Locate connectors P3 & P9 on the right-side-rear of the unit.
2. Attach the wires and tighten the retaining screws. Tug gently on the wires to verify the connection.

#### Wiring Example: Current Input with Sensor Excitation

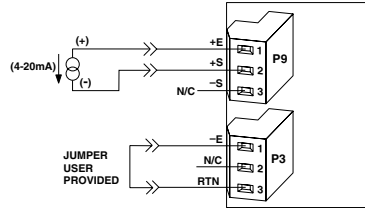

3. Apply ac power. The front panel of the unit flashes RESET. If it does not:
  - a. Remove ac power.
  - b. Verify the P1 power and P3 and P9 input connections.
  - c. Check your power source.
  - d. Check your signal source.
4. Replace the rear cover. Thread the sensor wires through the slots on the side of the cover. Replace the rear cover screw.
5. Apply ac power once again.

### Configure the Meter

Use the front panel buttons to access the configuration menus, to either verify or set the unit values. The function of each button is described below:

#### Meter Button Descriptions

#### Press This Button To:

|  |  |
|--|--|
|  | sequentially recall previous setpoint settings (run mode only), store new setpoint values. |
|  | access the configuration program menus and move from one menu to the next.                 |
|  | enter and scroll through a submenu.  |
|  | change the value of a submenu.   |
|  | move backward one menu (press once) or exit the configuration menus (press twice).         |

## 3

### Quick Start Setup

Quick Start Setup scales your meter to read 0 to 100.0 for a 4 - 20mA input. This setup procedure is actually a series of short tasks. To complete Quick Start Setup successfully, it is important to perform all tasks in the order outlined in the Quick Start Setup.

#### Select Input Range

1. Press MENU until the meter displays:
2. Press MIN until the meter flashes: Press MENU and "CURRNT" stops flashing. Press MIN to display a flashing input range of 4-20mA or 0-20 mA. Press MAX until the meter displays "4-20mA."
3. Press MENU. The meter stores changes (if applicable), then displays "RDG.CNF":

#### Set Up Reading Configuration

1. Press MIN to display "RDG.1". Press MAX until the meter displays "RDG.1=0". Selecting "RDG.1=0" enables direct formatting.
2. Press MIN to display "RDG.2". Press MAX until the meter displays "RDG.2=1". Selecting "RDG.2=1" enables an active decimal point.
3. Press MENU. The meter stores changes (if applicable), then displays "RDG SC":

## 4

### Set Reading Scale Factor and Reading Offset

1. Press MIN to display the scale factor value. Change the value, if necessary, to read "1.00000" (Use MIN to scroll through digits and MAX to change the digit's value).
2. Press MENU. The meter stores changes (if applicable) then displays "RDG.OF":
3. Press MIN to display the offset value. Change the value, if necessary, to read "000000" (Use MIN to scroll through digits and MAX to change the digit's value).
4. Press MENU. The meter stores change, if applicable, then displays "IN CNF".

### Set Default Input Scale and Offset

1. Press MIN until the meter flashes. Change the value, if necessary, to read "INP.6=0" (Use MIN to scroll through INP submenu choices and MAX to select 0 as the value). Setting "INP.6=0" disables input scale and offset.
2. Press MENU. The meter stores changes, if applicable, then displays "IN.SC.OF".